PC-1-069 May 6, 2003

CONDENSATE DRAIN MAINTENANCE FOR ALL INSTRUMENT QUALITY (IQ) SYSTEMS AND OIL FREE SYSTEMS

MODELS

AFFECTED: ALL INSTRUMENT QUALITY (IQ) EQUIPPED MACHINES.

NHP1500WCU.

SYMPTOMS: DAMAGE TO THE AIREND OR DOWNSTREAM EQUIPMENT.

CAUSE: BLOCKAGE OF Y-STRAINER, ORIFICES, OR PIPING CAUSING

CONDENSATE TO ENTER THE AIRSTREAM.

REMEDY: WEEKLY, VERIFY DURING FULL LOAD OPERATION (MAXIMUM AIR

DELIVERY) THAT THE Y-STRAINERS, ORIFICES, AND PIPING ARE

NOT CLOGGED.

CONFIRM THAT WATER AND AIR ARE BEING EJECTED FROM INTERSTAGE (NHP1500WCU), AFTERCOOLER AND IQ FILTER DRAINS (HP1600, HP1300) BY LOOSENING EACH OF THE CONDENSATE DRAIN LINE FITTINGS AT THE MUFFLER.

LINES ARE OPEN IF AIR AND WATER ESCAPE.