

Technical Service Bulletin



Doosan purchased Bobcat Company from Ingersoll-Rand Company in 2007. Any reference to Ingersoll-Rand Company or use of trademarks, service marks, logos, or other proprietary identifying marks belonging to Ingersoll-Rand Company in this manual is historical or nominative in nature, and is not meant to suggest a current affiliation between Ingersoll-Rand Company and Doosan Company or the products of either.

Number: PC12-20

Date: February 24, 2005 **Revised (10-12)**

Subject: Incorrect location of Fuel pump wiring and adding a fuse to the circuit

MODELS AFFECTED:

INDUSTRIAL GENSET MODELS S40 through S200

SYMPTOMS: Fuel pump may run when unit is off line.

CAUSE: Power wire to fuel pump may be connected to the wrong pin on the fuel pump relay.

REMEDY: 1. Check wiring at fuel pump relay K3, the W001 wire should be located on pin 87 of the K3 relay not pin 87a. correct if required. 2. Order and install fuse kit IR CPN 22595938 on circuit as shown in the instructions provided with the kit.

WARRANTY ACTION: Claims we be allowed for kit CPN 22595938, 1 hr. labor and actual travel time. we will accept claims until 6-20-05. Reference campaign # 05-1 on the claim.

