



## Technical Service Bulletin

*Doosan purchased Bobcat Company from Ingersoll-Rand Company in 2007. Any reference to Ingersoll-Rand Company or use of trademarks, service marks, logos, or other proprietary identifying marks belonging to Ingersoll-Rand Company in this manual is historical or nominative in nature, and is not meant to suggest a current affiliation between Ingersoll-Rand Company and Doosan Company or the products of either.*

**Number:** PC12-26

**Date:** February 13, 2006 **Revised (10-12)**

**Subject:** Removing K4 relay from control panel

**MODELS AFFECTED:** TELECOM GENSET MODELS N40 through N60 **with a K4 relay in lower area of Control Panel**

**SYMPTOMS:** Unit will not start after sitting idle or in Auto for more than 6 hours.

**CAUSE:** K4 relay is applying constant power to engine ECU.

**REMEDY:** 1. Remove K4 relay from the Circuit (located in the bottom of the control panel pedestal), tie up wires. **Please note this will disable the water temp readings on the unit when it is not running and may result in a water temp alarm upon starting, this is the permanent solution to this issue. If K 4 is not present no action needs to be taken.**

**WARRANTY ACTION:** Claims we be accepted until 6-1-06 for 1 hr. labor and actual travel time. Reference campaign # 05-6 on the claim.

