



## Technical Service Bulletin

*Doosan purchased Bobcat Company from Ingersoll-Rand Company in 2007. Any reference to Ingersoll-Rand Company or use of trademarks, service marks, logos, or other proprietary identifying marks belonging to Ingersoll-Rand Company in this manual is historical or nominative in nature, and is not meant to suggest a current affiliation between Ingersoll-Rand Company and Doosan Company or the products of either.*

**Number:** PC12-036

### FOR INFORMATION ONLY

**Date:** June 15, 2007  
**Revised (10-12)**

**Subject:** Engine harness wiring on John Deere ECU (pins pulling out)

**Symptoms:** Unit fails to start, or shuts down unexpectedly

**Models Affected:**

G80A	G125
Before serial number 232242	Before serial number 377356

### Remedy:

Order Kit CCN 23103385, which includes clamp 23084643 and bolt 96711908. Install bolt and clamp in engine block near oil fill. Push harness toward the ECU to relieve any tension on the ECU connector wires as shown in Figure 1.

**FIG 1**



### Warranty Action:

Warranty claims will be accepted for the kit and 1 hour labor per machine. Claims will be accepted until January 1, 2008.