



Technical Service Bulletin

Doosan purchased Bobcat Company from Ingersoll-Rand Company in 2007. Any reference to Ingersoll-Rand Company or use of trademarks, service marks, logos, or other proprietary identifying marks belonging to Ingersoll-Rand Company in this manual is historical or nominative in nature, and is not meant to suggest a current affiliation between Ingersoll-Rand Company and Doosan Company or the products of either.

Number: PC13-004

Date: May 1, 2007

Revised (10-12)

Subject: Counter Weight Bolt Torque ZX75 and ZX125 Excavators

Counter weight bolts may become loose during operation of the machine. Immediately include a check of these bolts in your maintenance program. Check should be made within every 500 hours of operation. Loose counter weight bolts should be checked for damage before re-torquing. Replace any damaged bolts, apply Loctite 243 and re-torque to 385Nm (284 ft-lbs).

