



## Technical Service Bulletin

*Doosan purchased Bobcat Company from Ingersoll-Rand Company in 2007. Any reference to Ingersoll-Rand Company or use of trademarks, service marks, logos, or other proprietary identifying marks belonging to Ingersoll-Rand Company in this manual is historical or nominative in nature, and is not meant to suggest a current affiliation between Ingersoll-Rand Company and Doosan Company or the products of either.*

**Number:** PC13-005

**Date:** May 1, 2007

**Revised (10-12)**

**Subject:** Counter Weight Bolt Torque on Wheel Loaders WL350 and WL450

Counter weight bolts may become loose during operation of the machine. Immediately include a check of these bolts in your maintenance program. Check should be made within every 500 hours of operation. Loose counter weight bolts should be checked for damage before re-torquing. Replace any damaged bolts, apply Loctite 242 and re-torque to 195Nm (144 ft-lbs).

