

Portable Compressor

Doosan purchased Bobcat Company from Ingersoll-Rand Company in 2007. Any reference to Ingersoll-Rand Company or use of trademarks, service marks, logos, or other proprietary identifying marks belonging to Ingersoll-Rand Company in this manual is historical or nominative in nature, and is not meant to suggest a current affiliation between Ingersoll-Rand Company and Doosan Company or the products of either.

PC-5-056

September 25, 1997 update

Revised (10-12)

ENGINE SPEED CONTROL

Models Affected: **P375BWCU**
 HP300BWCU

Symptoms: Erratic Speed and Pressure

Cause: **Broken injection pump shaft clamp**

Remedy: **Replace engine speed control lever with new design**

Some of the above listed models have had the clamp that attaches the speed control lever to the injection pump shaft break. To reduce stress on the clamp, the speed control lever has been redesigned. Machines that experience this failure should have the speed control lever replaced with the new design, part number 36892651.

Note: The part that breaks is a Bosch part and is available only from Bosch dealers. The Bosch part number is 1421903018.

Repairs made within the machine warranty period may be submitted on a warranty claim.

THIS IS NOT A CAMPAIGN.

Note: The old speed control lever part number 36888121 has been cross-referenced to the new part number 36892651.

Machines shipped from the factory as of August 22, 1997 have the new speed control lever installed.

Refer to updated sketch.

