

## Portable Compressor

*Doosan purchased Bobcat Company from Ingersoll-Rand Company in 2007. Any reference to Ingersoll-Rand Company or use of trademarks, service marks, logos, or other proprietary identifying marks belonging to Ingersoll-Rand Company in this manual is historical or nominative in nature, and is not meant to suggest a current affiliation between Ingersoll-Rand Company and Doosan Company or the products of either.*

**PC- 5-065**

**December 13, 1999**

**Revised (10-12)**


## ENGINE SPEED CONTROL

**Models Affected:** P375WCU prior to S/N 303480

**Symptoms:** Low Engine Speed  
Excessive Engine Vibration  
Broken Throttle Lever on Engine Fuel Pump

**Cause:** Lack of Idle Speed Adjustment

**Remedy:** Remove air cylinder rear support bracket 36888113  
Locate and drill two 9/32 inch holes in bracket per drawing below.

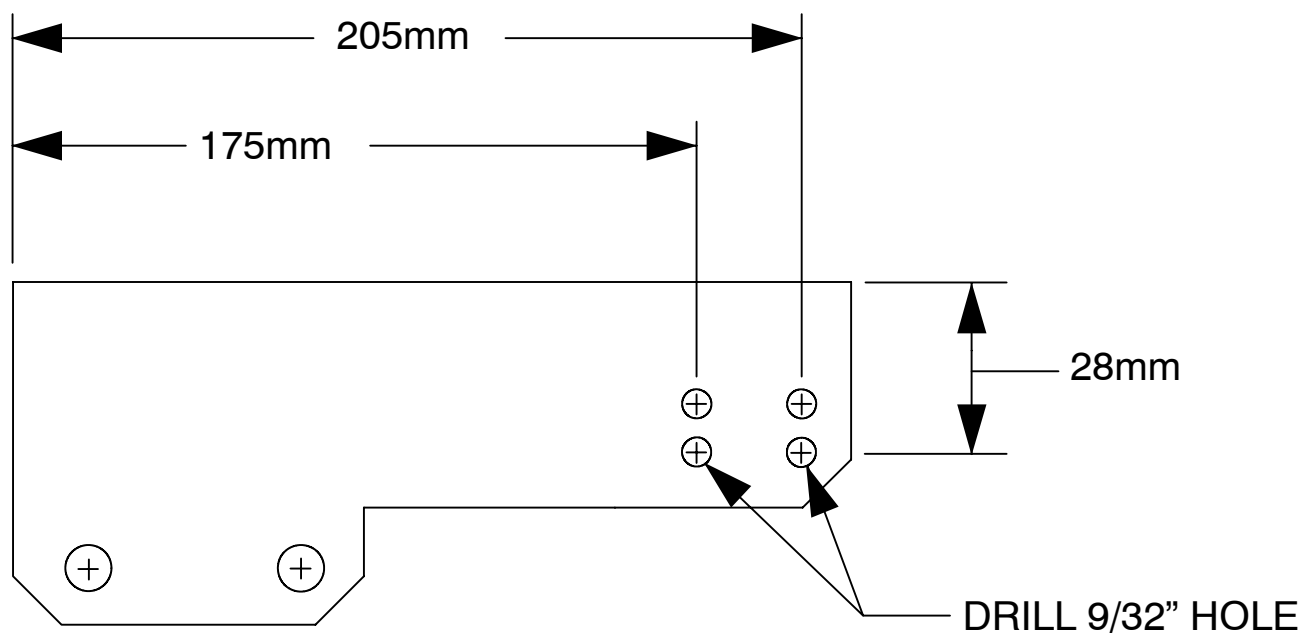

Claims will be accepted to implement this repair on machines within warranty that experience the above symptoms.

This is not a campaign.