



Technical Service Bulletin

Doosan purchased Bobcat Company from Ingersoll-Rand Company in 2007. Any reference to Ingersoll-Rand Company or use of trademarks, service marks, logos, or other proprietary identifying marks belonging to Ingersoll-Rand Company in this manual is historical or nominative in nature, and is not meant to suggest a current affiliation between Ingersoll-Rand Company and Doosan Company or the products of either.

Number: PC5-068

Date: February 24, 2006
Revised (10-12)

SUBJECT: Separator Tanks Cracking on Airsource and Airsource Plus

MODELS AFFECTED: Airsource, Airsource Plus-IR, Airsource Plus-JD

SYMPTOMS: Oil leaking at Separator Tank Mounting Brackets.

CAUSE: Vibration amplified by hard pipe between discharge of compressor and separator tank.

REMEDY: Replace hard pipe with flex hose.

PARTS REQUIRED:

- Flex Hose Part Number: 35309236
- Separator Tank Part Number: 22333900 (only if cracked and leaking)

WARRANTY ACTION:

Take immediate action to replace current hard pipe 22335491 with above flex hose. Warranty claims will be accepted for part and 1 hour labor.

Note: Travel time and mileage will not be allowed. Warranty claims will be accepted until June 30, 2006.

CLAIM MUST REFERENCE: CODE 06-1.