


Portable Power Service News | Oil System

Scavenge System arrangement change 9/274-9/304-12/254-17/244-21/224

[Figure 1]

A - Scavenge pipe/hose
B – Filter support brackets

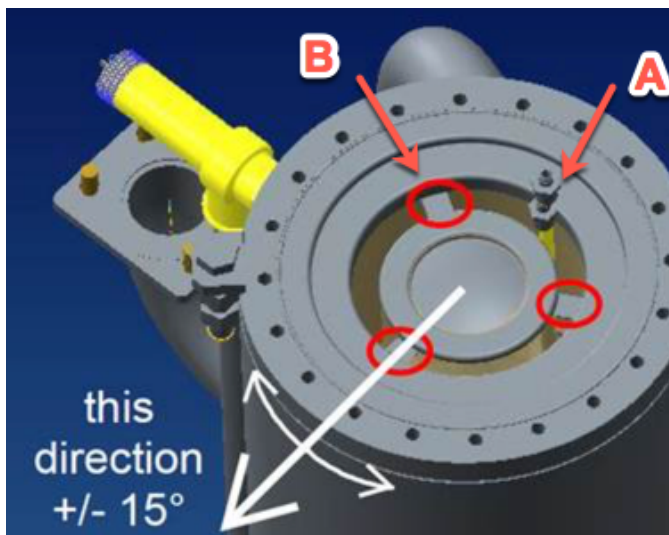

From factory these scavenge systems had been assembled using a section of steel pipe connected to a plastic hose. (Figure 2)

It was however observed that there is a potential for increased oil carryover due to a defect of the plastic hose just below the connection with the steel pipe.

Should your machine be subject to increased oil carryover , check the hose for damage and correct using the steel replacement pipe if required.(Figure 3)

Installation:

The full length steel pipe can be ordered under cpn 46553340.

When installing the new pipe, please observe the location of the filter reinforcement brackets in relation to the scavenge pipe to ensure they do not make contact. (Figure 1)

Factory Rework:

The new full length steel pipe was installed in production from serialnumber:

- 17/244-21/224 → 883127
- 9/274-9/304-12/254→ 895257

[Figure 2] original steel pipe+hose



[Figure 3] Full length steel pipe

